

~ THE PROBLEM ~

The side lights on the *Mega Man Wearable Helmet* do not illuminate.

~ ITEMS NEEDED ~

- Flat-head screwdriver with thin blade (the thinner the better)
- Two AAA batteries



~ STEP 1 ~


Open the crest on the top of the helmet to expose the battery holder.

Take note of the positive terminals on the battery box (the thin pieces of metal positioned opposite of the coils).

~ STEP 2 ~

Insert the screwdriver blade between the positive terminal (the thin piece of metal) and the plastic wall of the battery holder.


*GENTLY* pry the metal and the plastic apart, so there is a small gap. This will bring the "nub" on the positive terminal closer inward for a better contact when the batteries are inserted later.

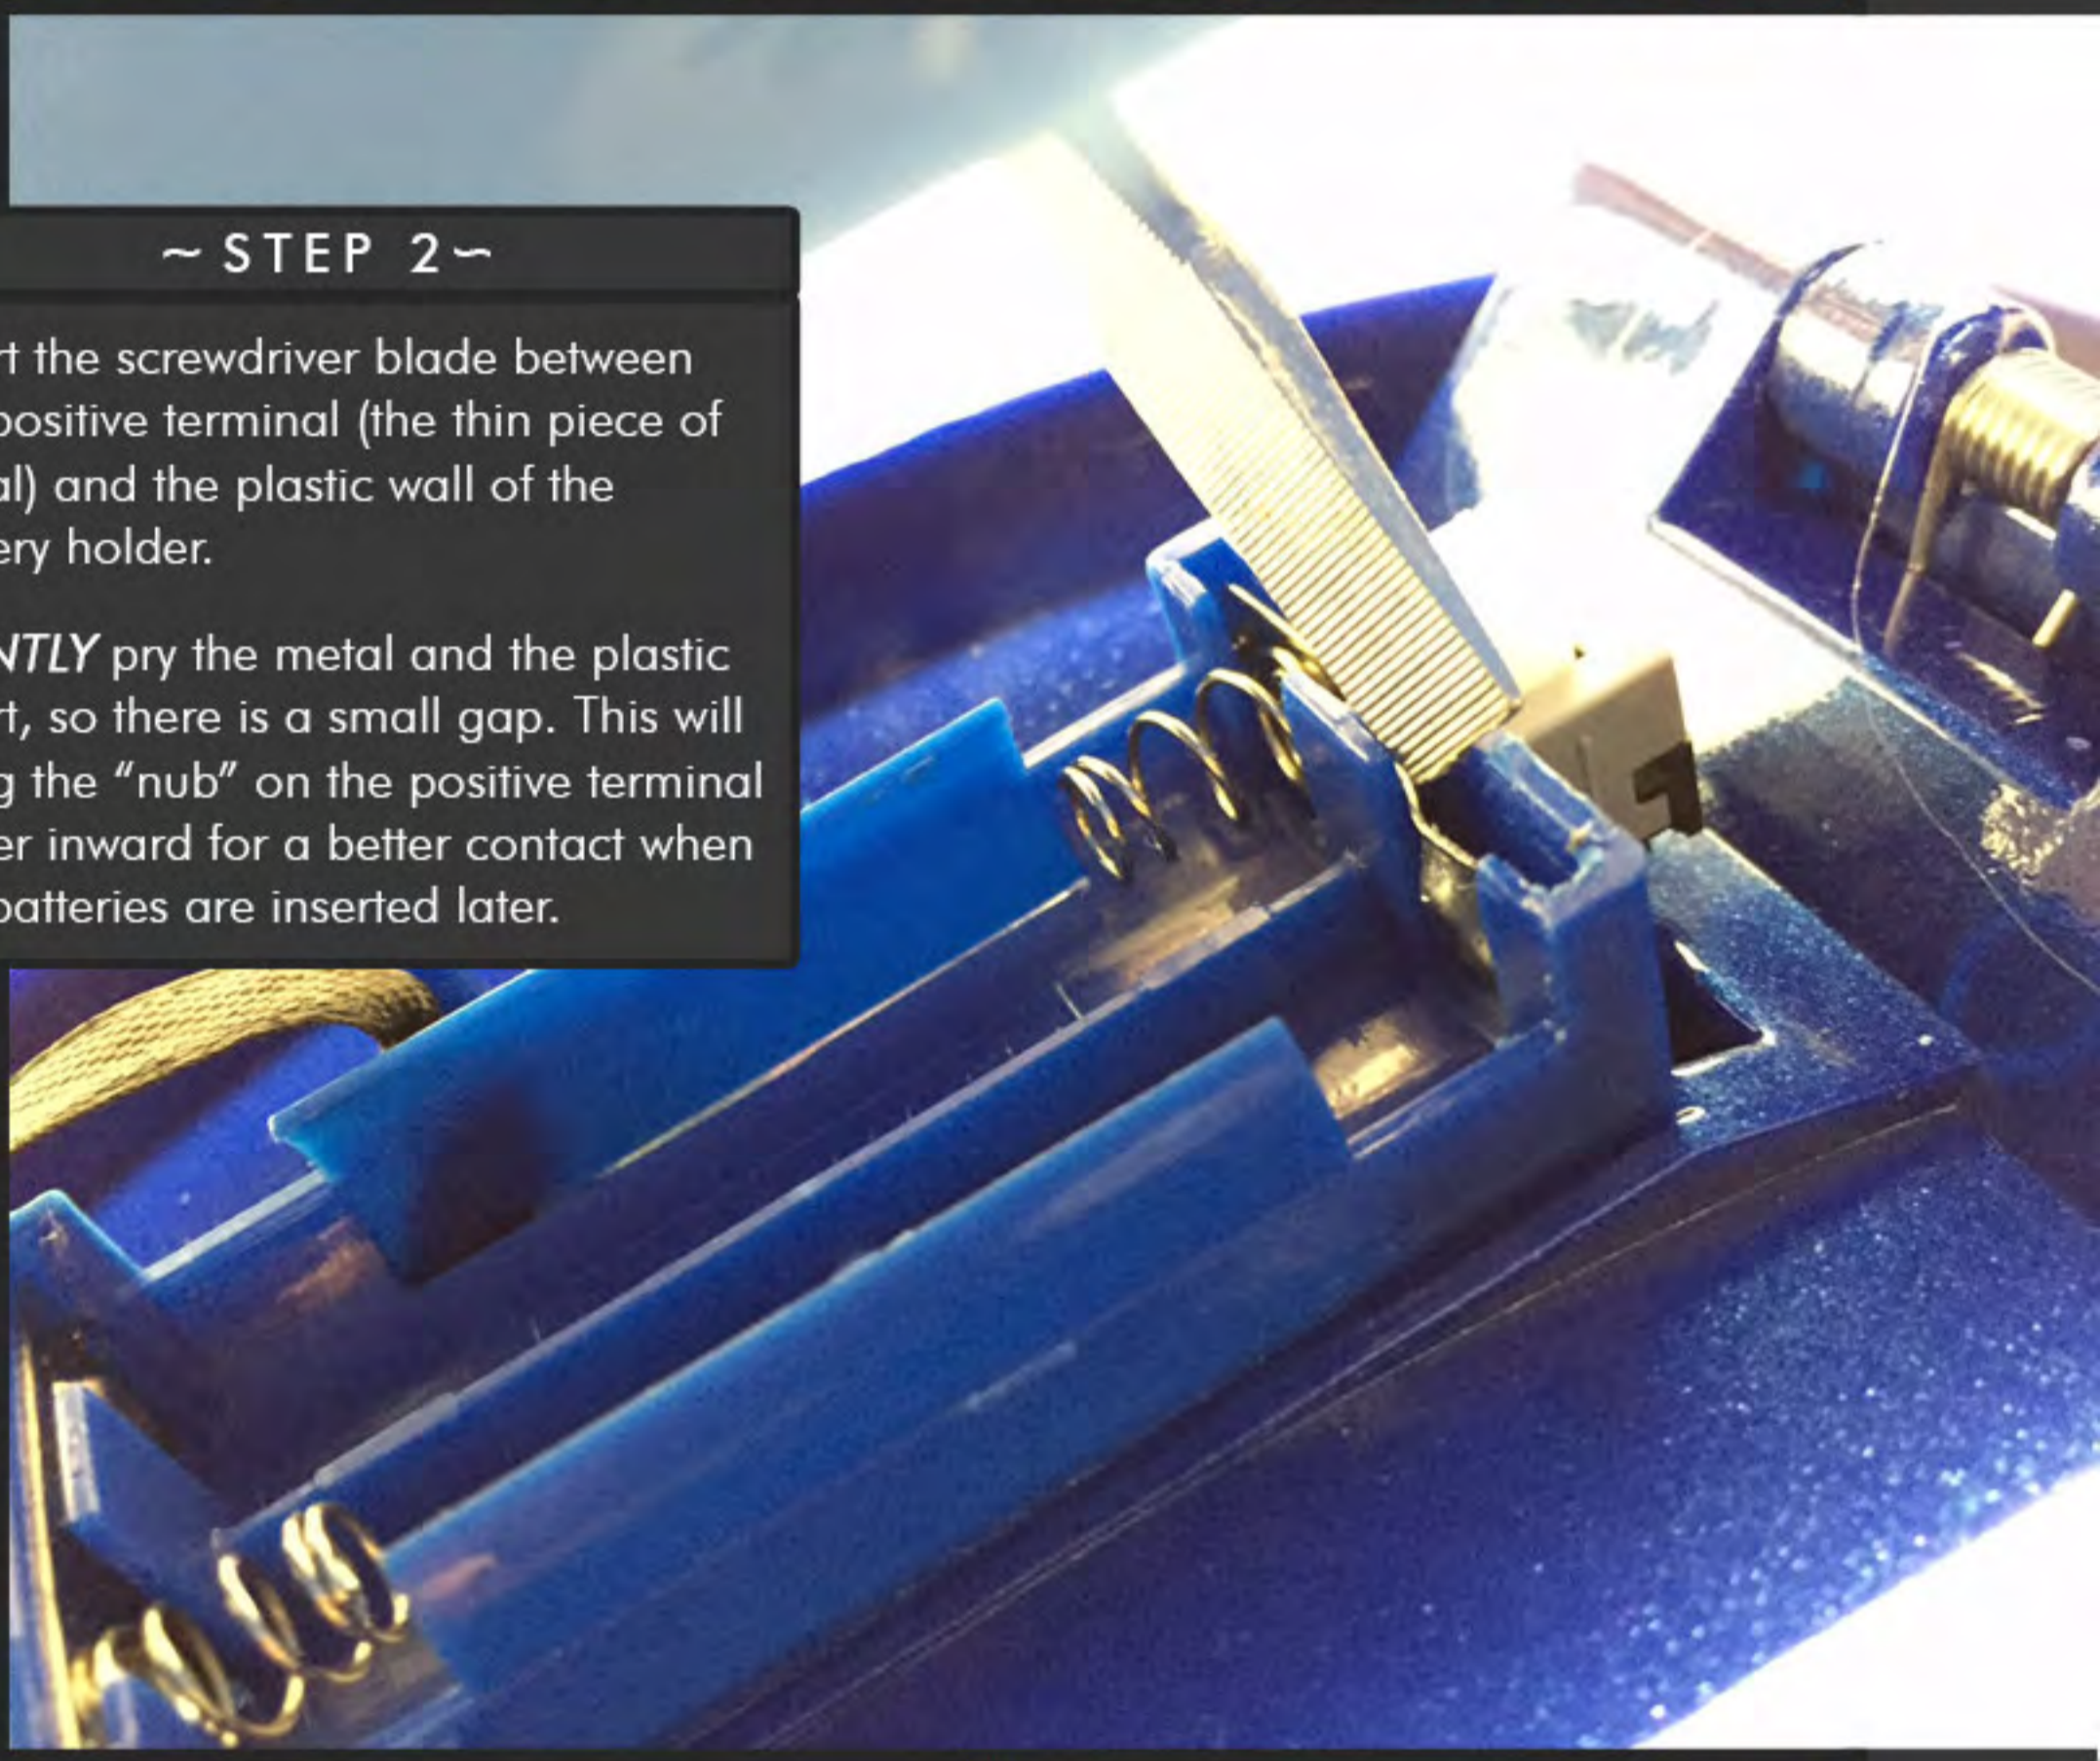

~ STEP 3 ~

Rotate the helmet and repeat Step 2 on the other positive terminal.

There is no need to tamper with the negative terminals (the metal pieces with coils).

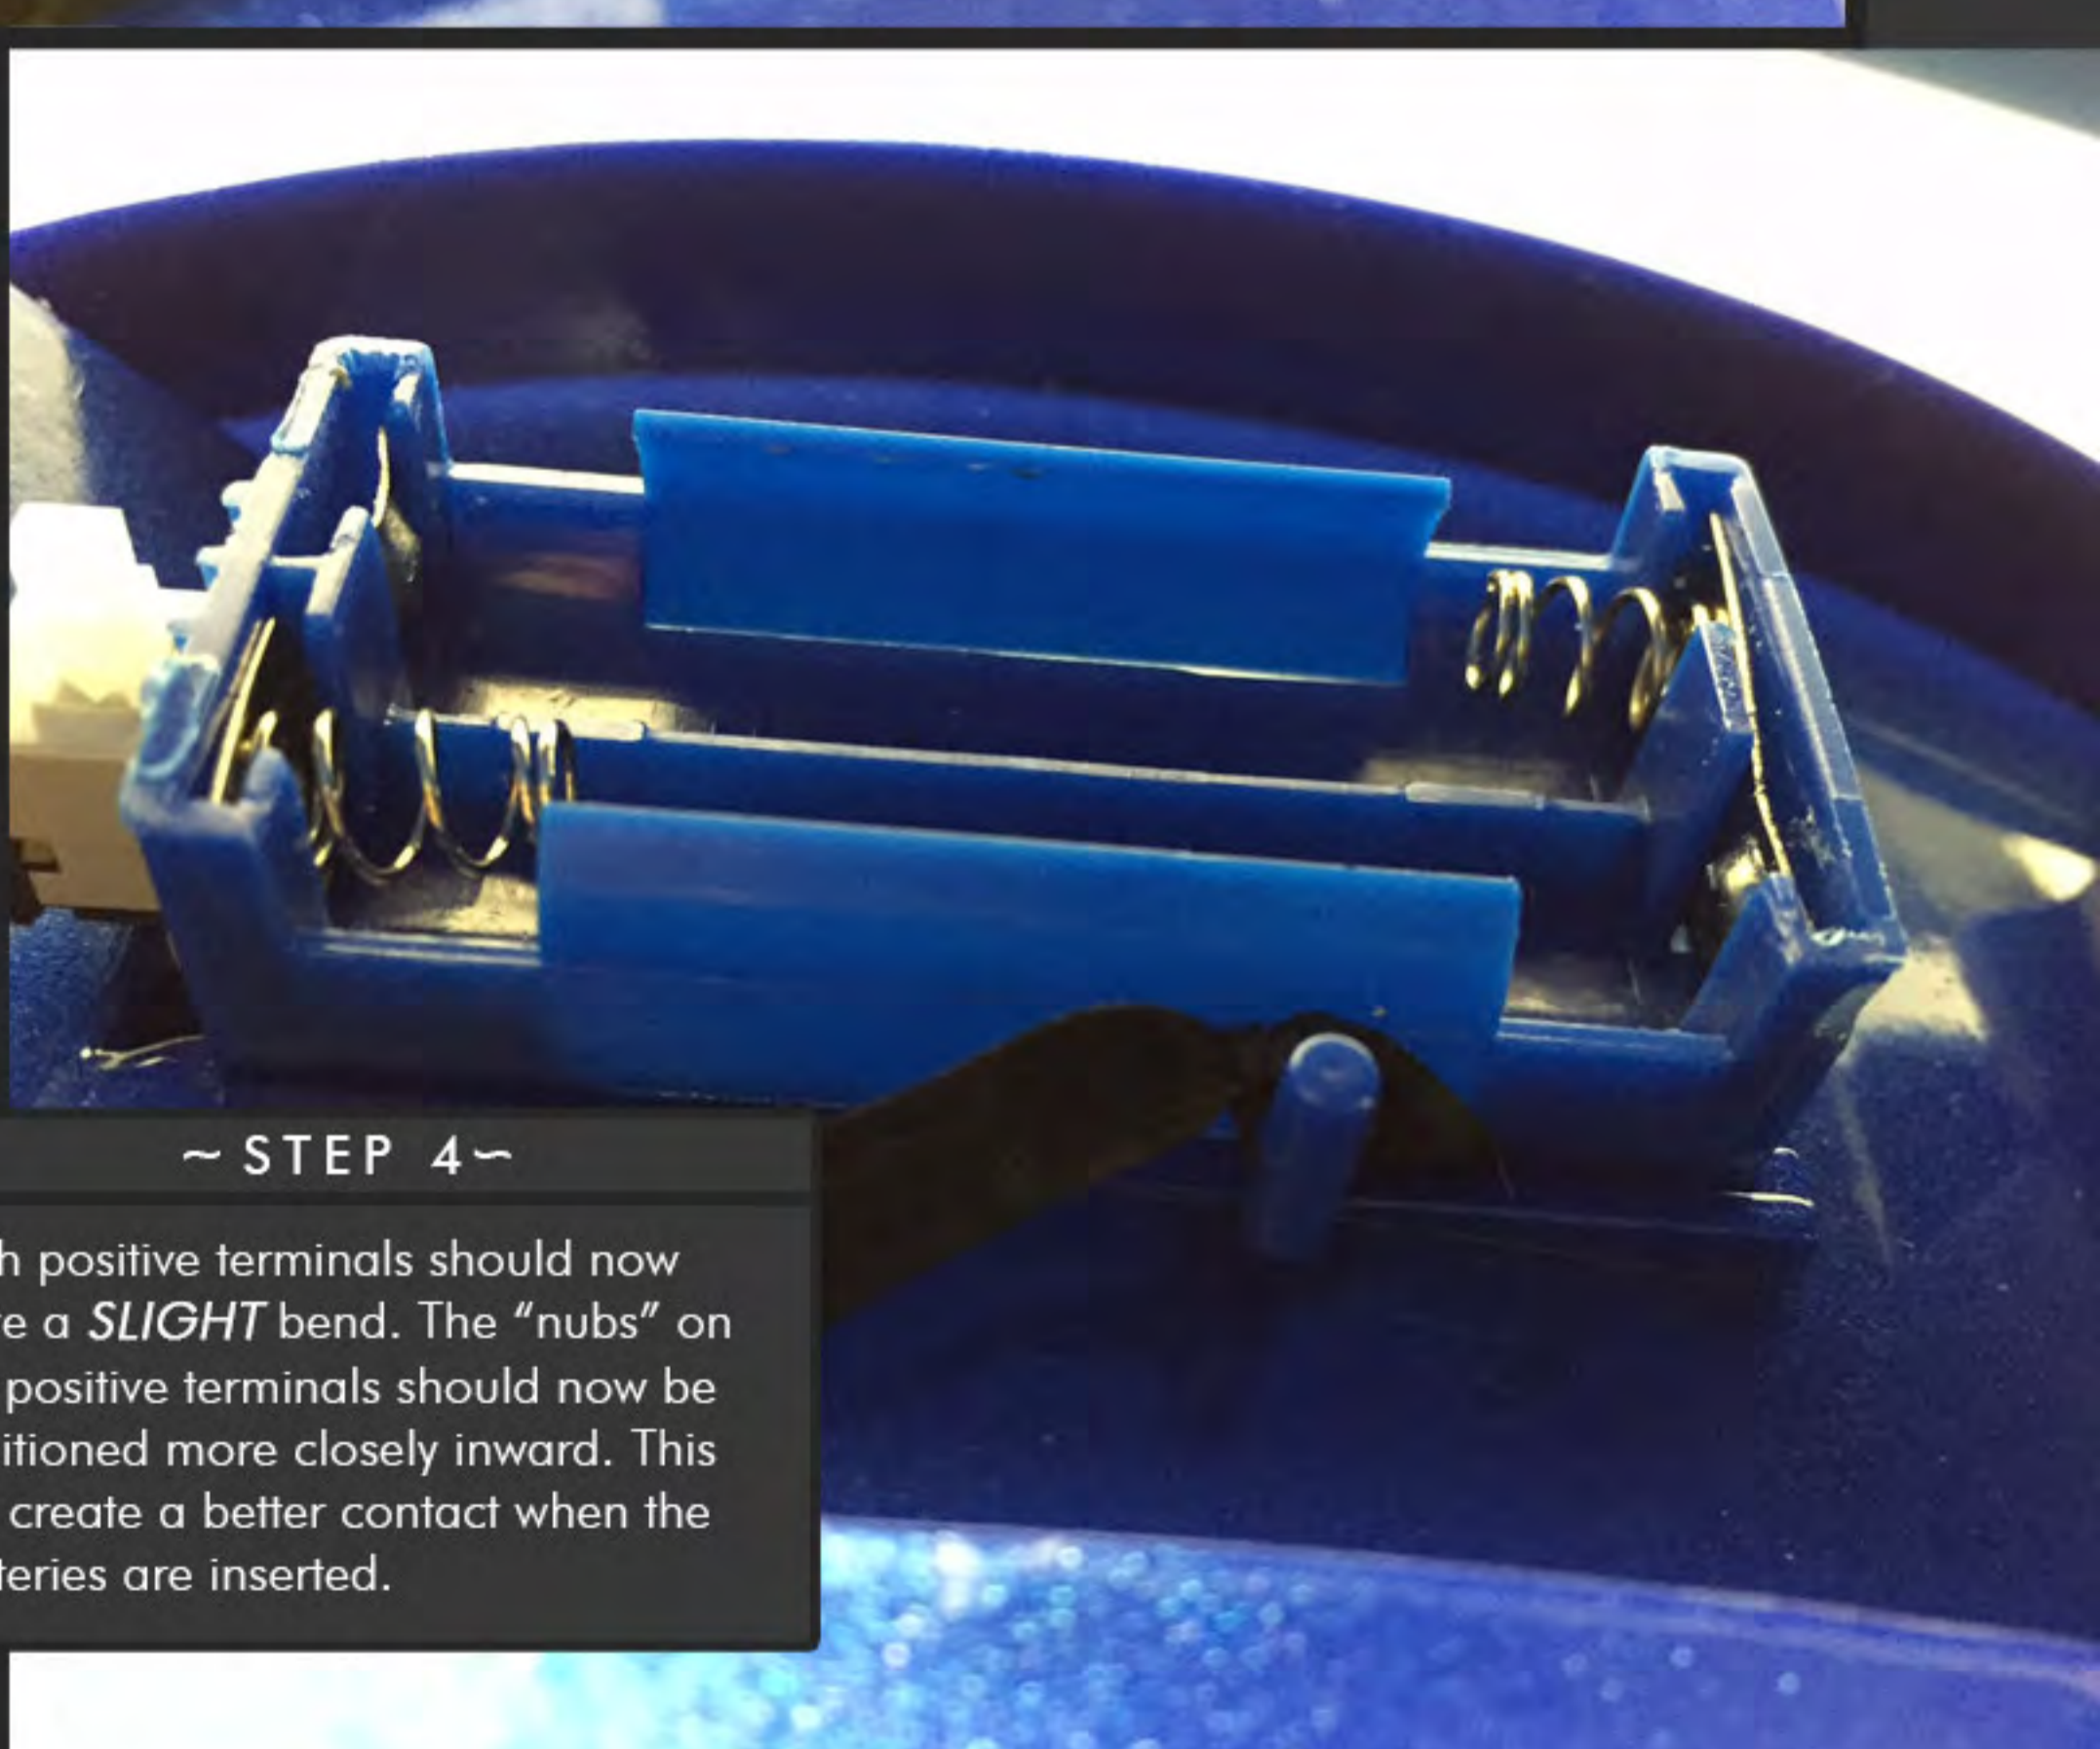

~ STEP 4 ~

Both positive terminals should now have a *SLIGHT* bend. The "nubs" on the positive terminals should now be positioned more closely inward. This will create a better contact when the batteries are inserted.



~ STEP 5 ~

Insert the two AAA batteries. Press the switch in front of the battery box to turn the lights on or off. The helmet should now be fully operational.